

FIELD TESTING OF GENERAL ELECTRIC TYPE OVERCURRENT TRIP DEVICES



These instructions do not purport to cover all details or variations in equipment nor to provide for every possible contingency to be met in connection with installation, operation or maintenance. Should further information be desired or should particular problems arise which are not covered sufficiently for the purchaser's purposes, the matter should be referred to the General Electric Company.

FIELD TESTING OF GENERAL ELECTRIC TYPE OVERCURRENT TRIP DEVICE

GENERAL

Increased interest in breaker maintenance is evident by the increase in field inquiries concerning maintenance procedures. Since the majority of these inquiries concern checking the operation of overcurrent trip devices, the following factory advice is offered as an aid to those involved in that activity.

Before attempting any checks or adjustments, the assigned tester should consult the maintenance manual to familiarize himself with the operating details of the specific breaker involved and the specific overcurrent trip device. He should be certain the power voltage has been removed. Prior to checking the overcurrent trip device, the breaker contacts, mechanism and trip latch should be checked to assure their proper functioning so that the breaker can carry the required current and that the trip shaft is free of high friction loads. The trip latch should be checked for proper trip latch engagement.

Overcurrent Trip Device Checks:

An adequate check to prove the overcurrent trip device functions properly consists of a mechanical check followed by an overcurrent operation.

Mechanical Check:

A careful mechanical check should be made of any magnetic overcurrent trip device to assure a successful tripping operation just before the armature reaches the fully closed air gap condition. This can be done by manually pushing the armature toward the closed air gap position, and determining how much further the armature moves after the breaker has tripped. This check to assure "positive trip" is within the tolerance specified in the breaker maintenance manual is important and can affect the apparent degree of time delay during a subsequent overcurrent timing test. If there is insufficient "positive trip" the armature may "bottom" on the magnet pole face without sufficiently displacing the trip latch. Slightly excessive "positive trip" may cause fast tripping while extremely excessive "positive trip" will allow the trip device armature to be loaded by the latch when the air gap is excessive. When the air gap is excessive, tripping force is at a low level compared to the force at short air gaps and the device may tend to stall or "ride the latch".

The armature of the EC-2, EC-2A, EC-1A and EC-1B of the AK breakers and the oil film (sticky disk) and Grade "B" time of AL-2 type breakers can be manipulated directly while observing the tripping. On the EC-1 device the trip arm is not fastened to the armature. To accurately determine the degree of positive trip on the EC-1, it is necessary to "probe" the armature through the holes provided in the case. A drill rod or short length of stiff wire will serve as a probe. Maintenance manuals for the specific breaker shows the procedure in detail.

While checking positive trip, the armature should be held in the tripped position sufficiently long to assure the time delay escapement is operative as follows:

a. As the armature is pushed to the closed air gap position, devices with instantaneous trip features will allow the instantaneous trip spring to stretch and allow temporary separation of the armature from the time delay dashpot. Maintaining the armature in the closed air gap condition will cause the instantaneous spring to pull the dash pot through its timing stroke. Devices with long delay characteristics will require considerable time to "time out." Failure of the dashpot

to move at all warrants further investigation to see if a bind exists in the dashpot or connecting linkage. Similarly, lack of any time delay (when the device is so equipped) or a very fast "time out" will generally indicate lack of oil and again further investigation is warranted.

- b. When releasing the armature after the device has "timed out" check the armature to be sure it returns to the fully open gap position and rests on the armature open air gap stop. An armature hanging half-way closed indicates a possible bind in the armature pivot or dashpot or possibly the pick-up setting has been reduced so far below the minimum setting that the calibration spring no longer provides resetting torque. Binds in the armature pivot of devices employing oil displacement type dashpots are generally detected by the armature failing to fully reset following a partial "timing out" operation (such as may occur from a motor starting operation). On the next overload the partially closed air gap causes premature tripping. (Generally considered a fail safe condition.)
- c. Visually check for missing hardware, clamping devices, evidence of leaking oil, broken cases, cracked breaker trip paddles. On oil film (sticky disc) devices and Grade B timers, the condition of the oil should be observed and changed if necessary. Se maintenance manual for acceptable cleaning methods and type of oil.

Overcurrent Check:

If desired, an overcurrent test can be made to assure the breaker will trip on overcurrent. The purpose of overcurrent testing of trip devices in the field should be to determine if the breaker will perform as required for that circuit to which it is applied. Since the trip device exhibits its lowest trip force levels when encountering low levels of overcurrent, an indication of adequate trip device performance can generally be assured by making an overcurrent check at approximately 150 to 300 percent of coil rating as shown in Table I. On dual magnetic trip devices, the armature and pivot pin is common to both the long time delay feature and the instantaneous trip. If the force generated across the air gap is sufficient to attract the armature for slight overcurrents in the long time region, tripping on short circuit by the same armature is assured. As the armature times toward the closed air gap position, the force across the air gap increases high enough to stretch the instantaneous spring and exercise the instantaneous trip parts. Similarly, the short time armature on selective trip devices is on the same pivot as the long time armature and the iron structure is comparable. Therefore, checking the long time delay feature affords reasonable assurance of all features successfully performing their trip functions. The long time delay pick-up should be set at 100% current.

Overcurrent Test Equipment:

In addition to being capable of producing current levels approximately 300% of trip coil rating, the current must be reasonably sinusoidal. Since overcurrent trip devices are designed to saturate slightly above continuous rating to avoid destructive forces at short circuit levels of overcurrent, the devices represent a non-linear impedance at current levels recommended for time delay testing. If the trip device represents the predominant impedance in the test circuit, a non-sinusoidal current wave shape results. To maintain a reasonably sinusoidal wave shape of current, air core reactance should be inserted in the series circuit. The air core reactance must represent the predominant reactive (and linear) impedance to minimize the effect of the trip device impedance. Insertion of this additional impedance in turn requires an increase in test voltage. The minimum external impedance requirement varies for each coil size. The smaller the rating of the trip coil, the higher becomes its impedance, the more external impedance is required, hence the higher the required source voltage. Rather than specify the external impedance required for each coil rating, it is more convenient to indicate the open circuit voltage required for various coil ratings. The

external impedance can then be inserted as required to control the test current. Figure 1 shows these open circuit voltage requirements for various coils. This voltage can be quickly checked after the current has been set by measuring the voltage with the breaker open and the test set "on" at the level required to produce 300% continuous current.

Test Procedure:

- 1. With a test set meeting the minimum requirements outlined above and connected securely to the upper and lower studs of one pole of the breaker, set the long time pick-up setting on the trip device to 100%. The relative position of the adjustable time setting of EC-2 type devices should be noted. It is important that time adjusting screw is not forced to the limit of its travel; otherwise binding of the time delay linkage may result.
- 2. Close the breaker and adjust the current to the degree of over-current listed in Table I for the particular O. C. trip device.
- 3. Shut off the test set to allow the device to re-set.
- 4. Re-apply the power and record the trip time in the appropriate test log book.

If repeat tests are attempted, it will be necessary to allow a sufficient cooling time between tests so as not to exceed the thermal capacity of the circuit breaker.

The magnets of some overcurrent trip devices are oriented in such a direction that the flux across the air gap of the device of one pole effects the pick-up of the devices on adjacent poles. Generally, these breakers have correction factors applied to their single phase calibration currents to assure adequate performance when applied on 3 phase circuits. These correction factors should be similarly applied when field checking. Notes on Table I indicate the correction factors to be applied. Test data should be compared with acceptable or specified limits so that discrepancies can be verified immediately.

On completion of the overcurrent trip device test, it is important to carefully reassemble any accessories that were removed to facilitate the overcurrent trip device test or adjustments. Any adjustments to those accessories should be made as directed by the maintenance manual. Careless reassembly of accessories may result in subsequent serious damage to the breakers and the circuits they protect.


Test Results:

The trip time measured for the trip device at the recommended overcurrent condition should be compared with the factory trip curve for new devices. In view of the wide variation in the parameters responsible for the apparent degree of time delay from a trip device, tripping times will often exceed the band width shown on the characteristic curves. These variations can be caused by variations in the current wave produced by test equipment, wide deviations in ambient temperature or high oil temperature caused by repetitive testing. Field adjustments, if necessary, should be confined within the adjustable range designed into the device for field adjustments. Replacement parts (other than cases or clamping hardware) are not generally available for overcurrent devices. When replacement devices are required, complete nameplate information extracted from the overcurrent trip device and the involved breaker should accompany the order.

TABLE I

Breaker Type	Type Overcurrent Trip Device	Test Current in Percent of L.T.D. Pick-up *
AL-2	Oil film (sticky disc) Grade B	150 150
AK-15/25/50	EC-1	150
AK-15/25/50	EC-2, EC-2A (inst. 4X)	150
AK-15/25/50	EC-2, EC-2A (inst. 6X or higher)	300
AK-1-75-100	EC-1	150 **
AK-2-75-100	EC-1A, EC-1B	150 ***

- * Pick-up set at 100% of trip device rating.
- ** Characteristics having XX suffixes should have 147% correction factored into current. Correction factors for YY characteristics are 160% on left and right poles and 187% on center poles.
- *** Correction factors of 93 and 107% for left and right poles respective must be factored into test currents.

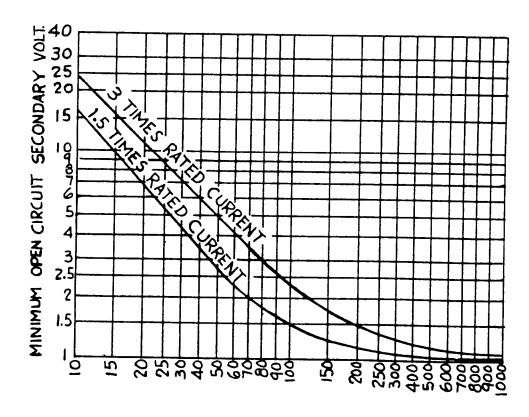

AMPERE RATING OF TRIP DEVICES FIG- 1

GENERAL ELECTRIC INSTALLATION AND SERVICE ENGINEERING OFFICES

FIELD SERVICE OFFICE CODE KEY

- Mechanical & Huclear Service
 Electrical & Electronic Service
 Marine Service
 Transportation

FOR YOUR LASTING SATISFACTION . . . with the performance and availability of your General Bectric equipment, GE provides this nationaride network of field service offices, serving utility, industrial, transpertation and marine users. Qualified field engineers provide instellation, serving, one gives training, empiricaning maintenance and other services, throughout the productive life of the equipment, for full information, cell your nearest installation & Service feedows are affected.

ALABAMA	LOUISIANA	OKLAHOMA
† Birmingham 35205 2151 Highland Ave.	† Baton Rouge 70806 8312 Florida Blvd.	* † Oklahoma City 73106 2000 Classen Blvd.
* † \$ Mobile 35609 1111 S. Beltline Highway	*† 1 New Orleans 70125 4747 Earhart Blvd. *† * Shreveport 71104 2640 Centenary Blvd.	† Tulsa 74105. P.O. Box 7646, Southside Sta.
ALASKA	† Monroe 71201 1028 North 6th St.	
f Anchorage 99501, 115 Whitney Rd.		OREGON
•	MARYLAND	† Eugene 97401 1170 Pearl St.
ARIZONA	* † 1 Baltimore 21201 1 N. Charles St.	* † 1 Portland 97210 2929 NW 29th Ave.
* † Phoenix 85012 3550 N. Central Ave.	. ,	
† Tucson 85716 151 S. Tucson Blvd.	MASSACHUSETTS	PENNSYLVANIA
	* † † Wellesley 02181 1 Washington St.	* Allentown 18102 1444 Hamilton St.
arkansas	• • • • • • • • • • • • • • • • • • • •	* † ‡ Philadelphia 19102 3 Penn Center Plaza
† North Little Rock 72119 120 Main St.	MICHIGAN	* † Pittsburgh 15222 300 6th Avenue Bldg.
CALIFORNIA	* † ‡ Detroit 48202 700 Antoinette St.	
	Jackson 49201 210 W. Franklin St.	SOUTH CAROLINA
* † 1 Los Angeles 90054 212 N. Vignes St.	† Saginaw 48607	† 1 Columbia 29204 2700 Middleburg Dr.
† Palo Alto 94303 960 San Antonio Rd. † Sacramento 95808 2407 J St.	1008 Second National Bank Bidg.	† Greenville 29507 41 No. Pleasantburg Dr.
San Diego 92103 2560 First Ave.		TENNESSEE
* 1 San Francisco 94119 55 Hawthorne St.	MINNESOTA	
* Vernon 90058 3035 E. 46th St.	† 1 Duluth 55802 300 W. Superior St.	*† Chattanooga 37411
741.00 44445	* † 1 Minneapolis 55416 1500 Lilac Drive So.	† Memphis 38130 3385 Airways Blvd.
COLORADO		mempus souss
* † Denver 80206 201 University Blvd.	MISSOURI	TEXAS
•	* † Kansas City 84199 911 Main St.	* † Amarillo 79101 303 Polk St.
CONNECTICUT	*	* † I Beaumont 77704
* † Meriden 06450 1 Prestige Dr.	MONTANA	* I Corpus Christi 78401 205 N. Chaparral St.
## CD TD 4	† Butte 59701 103 N. Wyoming St.	* † Dailas 75222 8101 Stemmons Freeway
FLORIDA	batte saidt tos in wyoming se.	* † El Paso 79945 215 N. Stanton
† 1 Jacksonville 32203 4040 Woodcock Dr. † 1 Miamt 33134 4100 W. Flagler St.	NEBRASKA	Fort Worth 76102 408 W. Seventh St.
* † 1 Tampa 33609 2106 S. Lots Ave.	* † Omaha 68102 409 S. 17th St.	* † 1 Houston 77027 4219 Richmond Ave.
1 1 tampe 33009 2100 S. Lots Ave.	, , , , , , , , , , , , , , , , , , , ,	San Antonio 78204 434 S. Main St.
GEORGIA	NEW JERSEY	
* † 1 Atlanta 30309 1860 Peachtree Rd., NW	* † Millburn 07041 25 E. Willow St.	UTAK
† 1 Savannah 31405 5002 Paulsen St.		† Salt Lake City 84111 431 S. Third East St.
	NEW YORK	
HAWAII	† 1 Albany 12205 15 Computer Drive, West	VIRGINIA
* † 1 Honolulu 96813 440 Coral St.	* † 1 Buffalo 14205 625 Delaware Ave.	* 1 Newport News 23801 311 Main St.
ILLINOIS	* † I x New York 10022 841 Lexington Ave.	† 1 Richmond 23230 1508 Willow Lawn Dr.
* † 1 x Chicago 60680 840 S. Canal St.	* Rochester 14604 89 East Ave. * † 1 Syracuse 13206 3532 James St.	† Roanoke 24015 2018 Colonial Ave.
1 1 Chicago costo	* † 1 Syracuse 13206 3532 James St.	I MANDRE STOTE 2010 COLUMNI AVE.
INDIANA	NORTH CAROLINA	WASHINGTON
† Evansville 47705 2709 Washington Ave.	* † 1 Charlotte 28207 141 Providence Rd.	* † 1 Seattle 98188
f Fort Wayne 46807 3606 S. Calhoun St.	* Wilmington	112 Andover Park East, Tukwila
* † Indianapolis 46207 3750 N. Meridian St.	Reigeiwood 28456 P. O. Box 186	† Spokane 99202 E. 1805 Trent Ave.
PORT .	-	
30WA	OHIO	WEST VIRGINIA
† Davenport 52805	† Cincinnati 45206 2621 Victory Pkwy.	* † Charleston 25328306 MacCorkle Ave., SE
P.O. Box 630, 1039 State St., Bettendorf	* † I Cleveland 44104 1000 Lakeside Ave.	W7440-14E1
KENTUCKY	† Columbus 43229 1110 Morse Rd.	WISCONSIN
† Louisville 40218 2300 Meadow Dr.	† 1 Toledo 43606 3125 Douglas Rd.	Apprecia statt 3003 west Cottage Dr.
. Constitute total 2300 Mesdow Dr.	Youngstown 44507 272 Indianola Ave.	† 1 Milwaukee 53202 515 E. Michigan St.
· · · · · · · · · · · · · · · · · · ·	SENERAL ELECTRIC SERVICE SHOPS	•
•	raitaites populitie estatus ellati	

WHEN YOU NEED SERVICE... These GE Service Shops will repair, recondition, and rebuild your electric apparatus. The facilities are available day and night, seven days a week, for work in the shops or on your premium that is not your nearest severices.

ALABAMA	LOUISIAN
 Birmingham 35211 1500 Mims Ave. , S. W. 	• E
Mobile 36609 721 Lakeside Dr.	• • •
ARIZONA	MARYLA
 (Phoenix) Glendale 85019 . 4911 W. Colter St. 	• • •
 Phoenix 85019 3840 W. Clarendon St. 	
• Tucson 85713 2942 So. Palo Verde Ave.	MASSACH
CALIFORNIA	
 Los Angeles 90301 6900 Stanford Ave. 	MICHIGA
 (Los Angeles) Anaheim 92805 	• • • •
3601 E. LaPalma Ave.	• 1
 (Los Angeles) Inglewood 90301 	
228 W. Florence Ave.	MINNESO
 Sacramento 95814 99 North 17th St. 	• [
* * (San Francisco) Oakland 94608	• • 1
1650 34th St.	
COLORADO	MISSOUR
• * Denver 80205 3353 Larimer St.	• • •
Denver 60203,	• • •
CONNECTICUT	NEW JER
 Southington) Plantsville 06479 	• 1
	NEW ME
	NEW ME.
FLORIDA	•
• Jacksonville 32203 2020 W. Beaver St.	NEW YOR
 (Miami) Hialeah 330101062 East 28th St. 	•
• * Tampa 33601 19th & Grant Sts.	• •
GEORGIA	•
 (Atlanta) Chambles 30341 	•
* Atlanta 2379 John Glenn Dr.	
Atlanta 23 19 John Clean Dr.	•
ILLINOIS	
 Chicago 60638 6045 S. Nottingham Ave. 	• 4
INDIANA	•
Evansville 47711 401 N. Congress Ave.	NORTH C
• Ft. Wayne 46803 1731 Edsall Ave.	• •
Hammond 46320 1138 164th Place	OHIO-
• * Indianapoits 46222 1740 W. Vermont St.	Onto.
- manuspoite tosse 1140 W. Fernight Ot.	•

IOWA
• (Davenport) Bettendorf 52722 . 1025 State St.

. Louisville 40209. . . . 3900 Crittenden Drive

KENTUCKY

LOUISIANA Baton Rouge 70814 10955 North Dual St. New Orleans 70114 1115 Dearmas St.
MARYLAND • Baltimore 21230 920 E. Fort Ave.
MASSACHUSETTS • • 4 (Boston) Medford 02155
MICHIGAN • • Δ (Detroit) Riverview 18075 Krause Ave. • Flint 48505 1506 E. Carpenter Rd.
MINNESOTA • Duluth 55807 50th Ave. W & St.Louis Bay • • Minneapolis 55430 2025 49th Ave. , N.
MISSOURI • * Kansas City 64120 3525 Gardner Ave. • * St. Louis 63110
NEW JERSEY • New Brunswick 08902 3 Lawrence St.
NEW MEXICO • Albuquerque 87109 4420 McLeod Rd. NE
NEW YORK
NORTH CAROLINA • • Charlotte 28208 2328 Thrift Rd.
OHIO • Akron (Canton) 44720

quipment	ine GE renewal parts are used to For full information about these shop or sales office.
OKLAH	DMA Tulsa 74145 5220 S. 100th East Ave.
OREGO	,
• •	Eugene 97402 570 Wilson St. Portland 97210 2727 NW 29th Ave.
DENNSY	TLVANIA
	Allentown 18103 668 E. Highland St.
•	(Delaware Valley) Cherry Hill, N. J., 08034
	Johnstown 15802 841 Oak St.
.:	Philadelphia 19124 1040 East Erie Ave. (Pittsburgh) West Mifflin 15122
	4930 Buttermilk Hollow Rd.
•	tora titto i i i i i i i i i i i i i i i i i
	CAROLINA
•	(Charleston) No. Charleston 29401
TENNES	
•	Knoxville 37914
	2621 Governor John Sevier Hwy.
•	Memphis 38107 708 North Main St.
TEXAS	
•	Beaumont 77705 1490 W. Cardinal Dr.
•	Corpus Christi 78401 115 Waco St.
	Dallas 75235 3202 Manor Way
•	Houston 77036 5534 Harvey Wilson Dr.
	Houston 77036 6916 Harwin Dr.
•	Midland 79701 704 S. Johnston St.
UTAH	
• •	Sait Lake City 84110 301 S. 7th West St.
VIRGIN	ta .
	Richmond 23224 1403 Ingram Ave.
•	Roznoke 24013 1004 River Ave., SE
WASHIN	CTON
	Seattle 98134 3422 First Ave., South
•	Spokane 99211 E. 4323 Mission St.
	/IRGINIA Charleston 25328306 MacCorkle Ave., SE
WISCO	NSIN
•	(Appleton) Menasha 54910 . , 1725 Racine St.
•	Milwaukee 53207 235 W. Oklahoma Ave.