

# INSTALLATION • OPERATION • MAINTENANCE I N S T R U C T I O N S

## TYPE CM PHASE BALANCE CURRENT RELAY

**CAUTION** Before putting relays into service, remove all blocking which may have been inserted for the purpose of securing the parts during shipment, make sure that all moving parts operate freely, inspect the contacts to see that they are clean and close properly, and operate the relay to check the settings and electrical connections.

### APPLICATION

The type CM relay is an induction type relay designed to protect polyphase electrical machinery against phase unbalance or phase failure.

As shown in Fig. 7 the relay may be used with either three or two current transformers. With three CT's the accuracy class must be at least 10H25 or 10L50; with two CT's the accuracy class must be at least 10H35 or 10L70. Otherwise CT errors during motor starting may cause undesired CM tripping.

### CONSTRUCTION AND OPERATION

The type CM relay consists of two main current units and their associated resistor and an indicating contactor switch (ICS), or an a-c indicating contactor switch (ACS). The principal component parts of the relay and their location are shown in Fig. 1 and 2.

#### Main Unit

Each main unit has a pair of electromagnets operating on a single disc. The disc is damped by a permanent magnet. Each disc carries its own set of contacts with the two sets being connected in parallel, in order that either disc may close the trip circuit. The electromagnet pair are mounted face to face on opposite sides of the disc, and so connected that the electrical torque of one electromagnet opposes that of the other, thus producing balanced operating torque on the disc when the magnitudes of the currents through each of the two electromagnets are equal. One of the electromagnets on the lower disc is connected in series with one of the electromagnets on the upper disc. Thus phase A current may balance phase B current on the upper disc, and phase B current balance C current on the lower disc. Consequently with balanced system conditions, no operating torque is

produced on the two discs, but with unbalanced conditions or an open phase the balance on the disc is upset and one or two sets of contacts close.

Each electromagnet has a main coil located on the center leg of an "E" type laminated structure that produces a flux which divides and returns through the outer legs. A shading coil located on one of the outer legs of the "E" structure causes the flux through that leg to lag the main pole flux. The out-of-phase fluxes thus produced in the air gap will cause disc rotation. A resistor located to the rear of each main unit is used as an aid in balancing the opposing torques by controlling the current flow through the shading coils.

\* For some CM relays, the front electromagnet may have adjustable plugs which are used to aid in calibration.

The contacts are single pole double throw. The moving contact is fastened directly to the disc shaft and the electrical connection is made thru a spiral spring fastened to the moving contact arm and frame assembly

#### Indicating Contactor Switch Unit (ICS)

The d-c indicating contactor switch is a small clapper type device. A magnetic armature, to which leaf-spring mounted contacts are attached, is attracted to the magnetic core upon energizing of the switch. When the switch closes, the moving contacts bridge two stationary contacts, completing the trip circuit. Also during this operation two fingers on the armature deflect a spring located on the front of the switch, allowing the operation indicator target to drop.

The front spring, in addition to holding the target, provides restraint for the armature and thus controls the pickup value of the switch.

#### A-C Indicating Contactor Switch Unit (ACS)

The A-C indicating contactor switch unit is a small a-c operated clapper type device. A magnetic armature, to which leaf-spring mounted contacts are attached, is attracted to the magnetic core upon energization of the switch. When the switch closes, the moving contacts bridge two stationary contacts completing the trip circuit. Also, during the operation,

**SUPERSEDES I.L. 41-181.2E**

\* Denotes changes from superseded issue.

**EFFECTIVE MAY 1973**

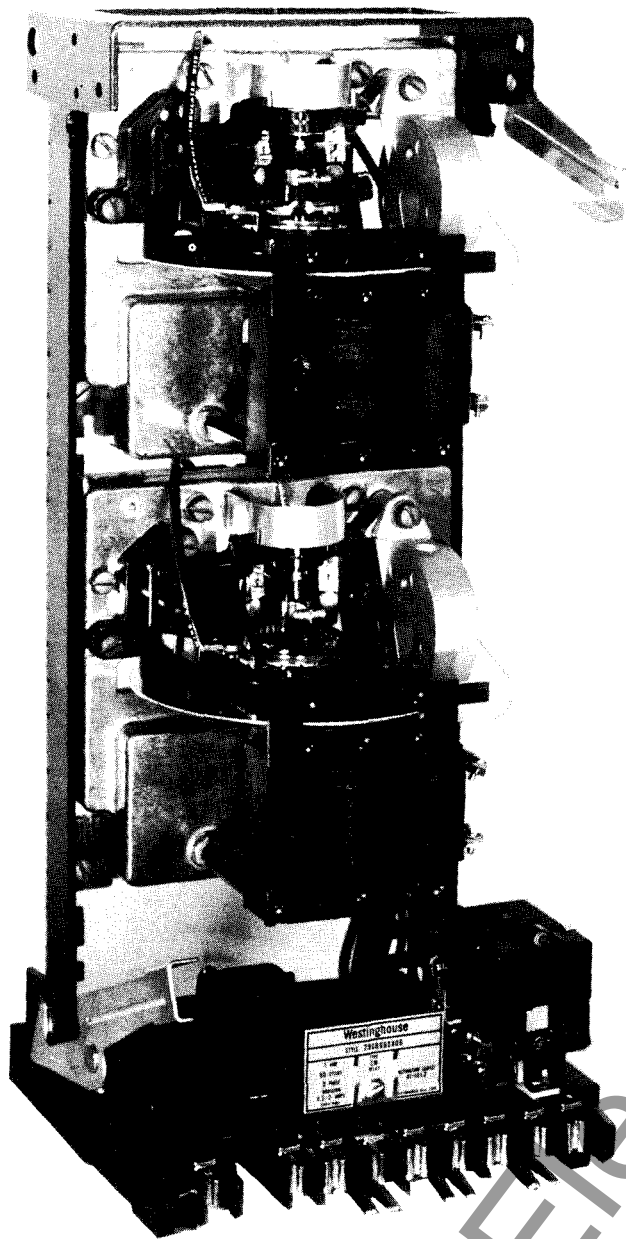


Fig. 1a. Non-Tapped Type CM Relay without case (Front View)

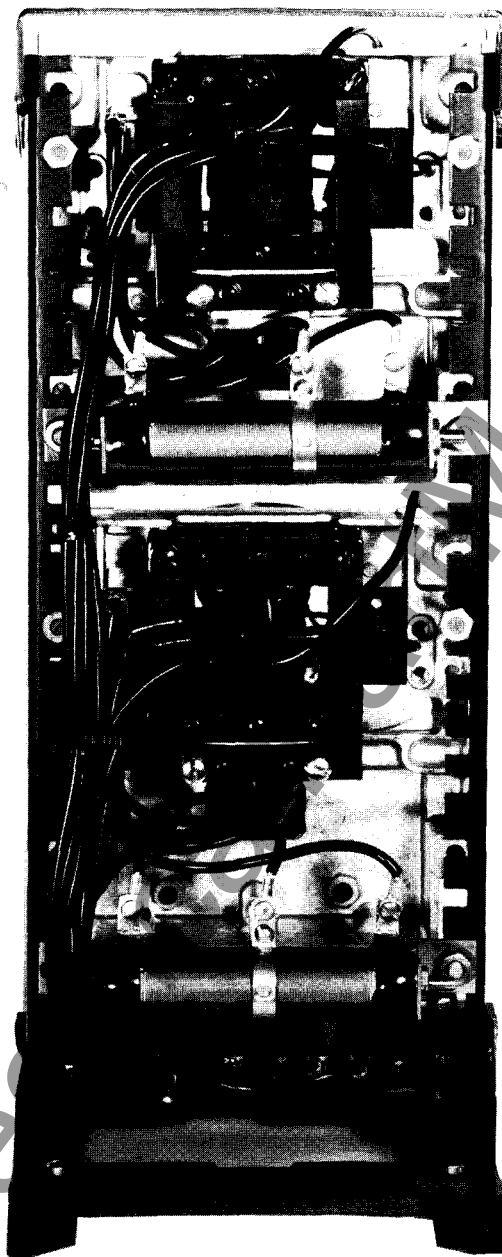


Fig. 1b. Non-Tapped Type CM Relay without case (Rear View)

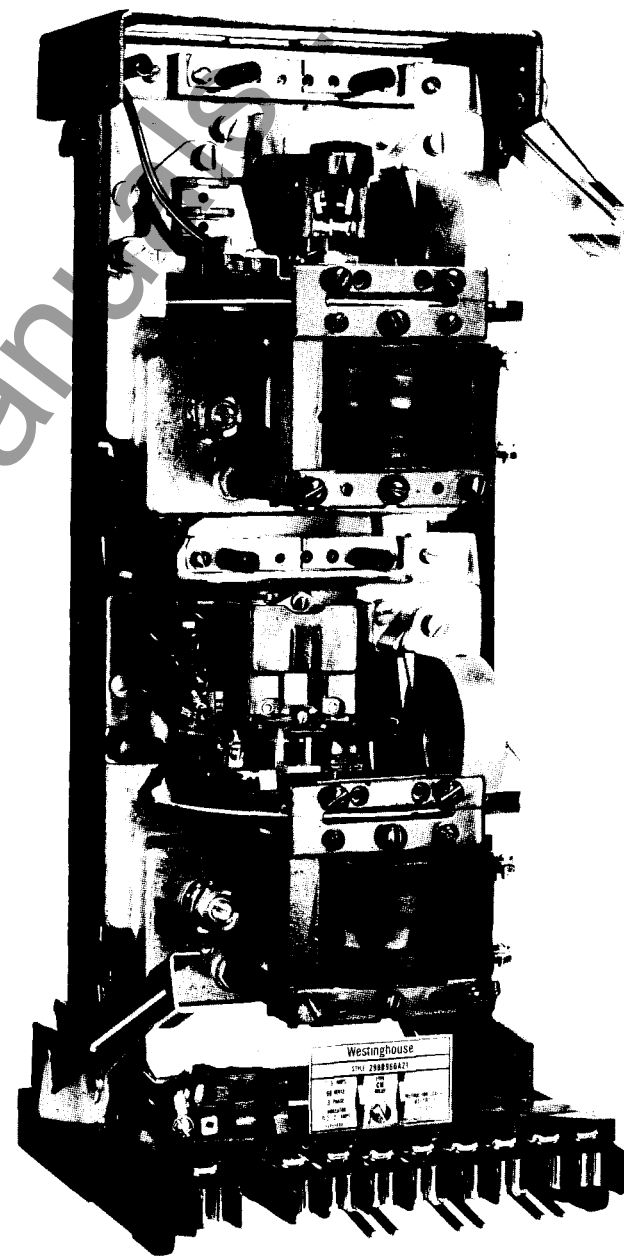


Fig. 2a. Type CM Relay without case (Front View)

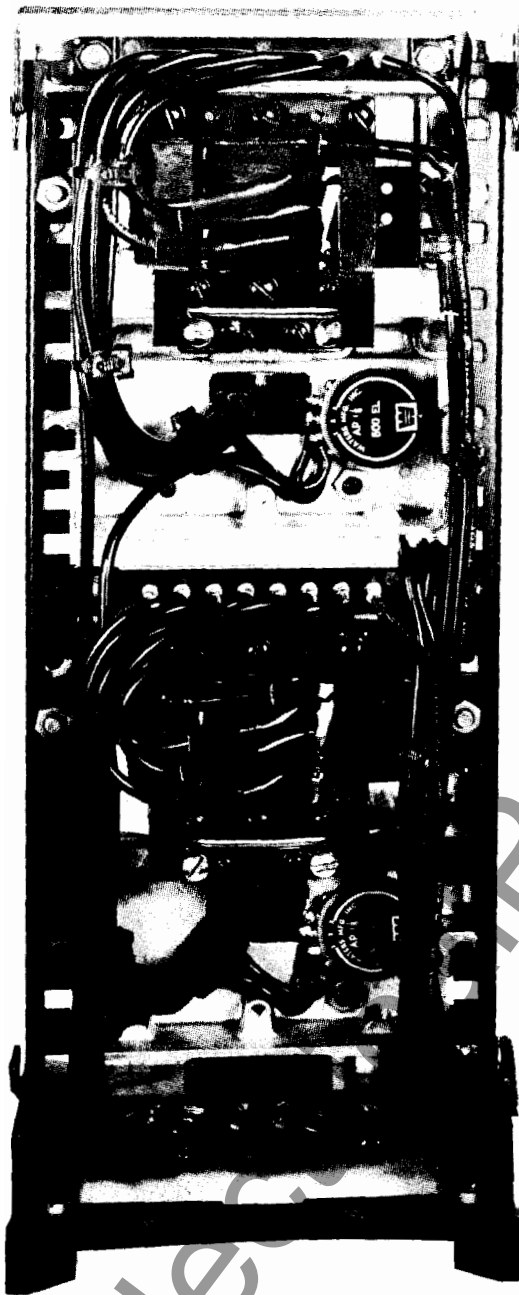


Fig. 2b. Type CM Tapped Relay (Rear View)

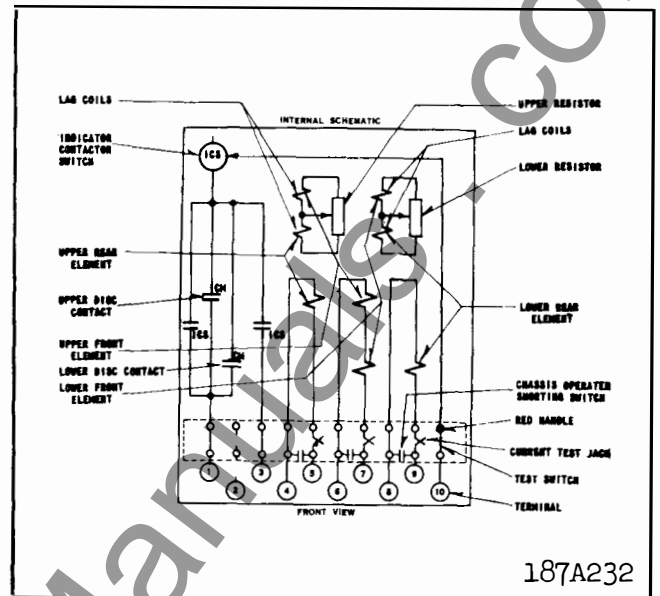


Fig. 3a. Internal Schematic of the non-tapped Type CM Relay in the Type FT31 Case.

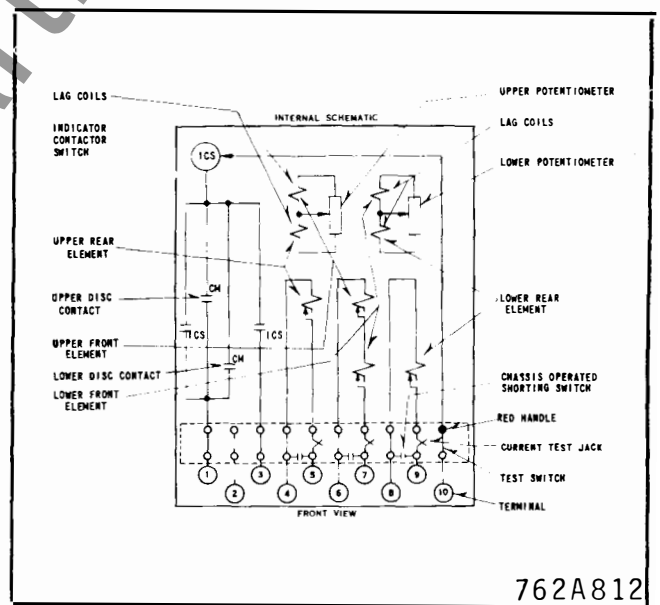


Fig. 3b. Internal Schematic of the tapped Type CM Relay in the Type FT31 Case

two fingers on the armature deflect a spring located on the front of the switch which allows the operation indicator target to drop.

## CHARACTERISTICS

The non-tapped type CM relay has a minimum pickup current of one ampere and a continuous thermal rating of seven amperes. The tapped CM Relay has a minimum pickup of 1, 2 or 3 amperes, depending on the tap setting and a continuous of 7 amperes. The minimum pickup current is defined as the pickup current of each electromagnet with the other paired electromagnet deenergized.

The relay may be utilized for continuous load currents of from one to seven amperes. The characteristic curve of the relay is shown in Figure 4.

### Trip Circuit

The main contacts will safely close 30 amperes at 250 volts d-c and the seal-in contacts of the indicating contactor switch will safely carry this current long enough to trip a circuit breaker.

The indicating contactor switch (ICS) has two taps that provide a pickup setting of 0.2 or 2 amperes. To change taps requires connecting the lead located in front of the tap block to the desired setting by means of a screw connection.

For .5 ampere ACS, the 1 second coil rating is 18.0 amperes a-c. For 1.0 ampere ACS, the 1 second coil rating is 44.0 amperes a-c

### Trip Circuit Constants

Contactor Switch—

ICS

0.2 ampere tap—6.5 ohms d-c resistance

2.0 ampere tap—0.15 ohms d-c resistance

ACS

.5 ampere ACS—18 ohms a-c impedance

1.0 ampere ACS—4.5 ohms a-c impedance

## ENERGY REQUIREMENTS

The burden of each electromagnet is as follows:

This represents the burden on the current transformer connected to terminals 4 and 5 or 8 and 9.

The burden on the current transformer connected to terminals 6 and 7 is twice the stated values.

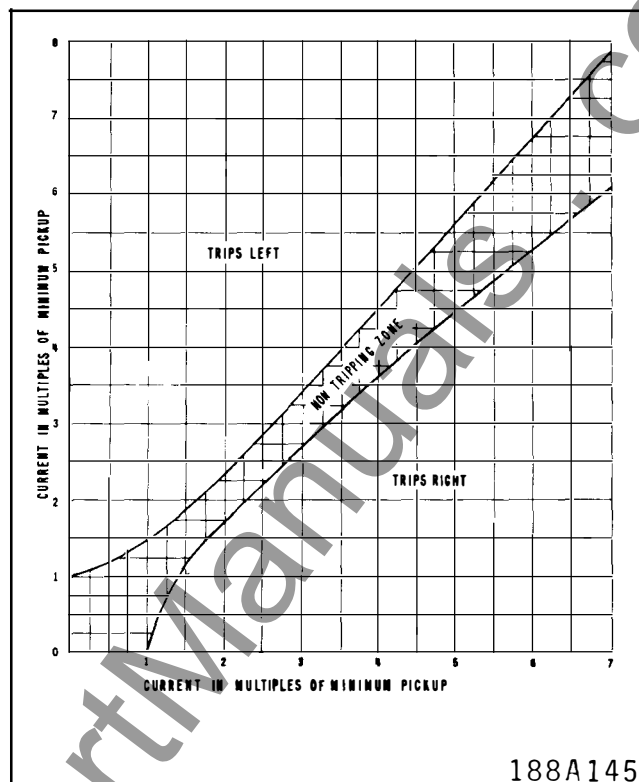


Fig. 4. Typical Operating Curve of the Type CM Relay

### Non-Tapped Relay

Current Amperes	Frequency	Volt Ampere	Power Factor Angle
1	60	.95	74
5	60	15.00	73
1	50	.85	72
5	50	14.5	71
1	25	.46	55
5	25	8.00	54

### Tapped Relay

Tap	Current Amperes	Frequency	Volt Amps.	Power Factor Angle
1	1	60	.95	74
1	5	60	15	73
2	2	60	.98	65
2	5	60	5.8	65
3	3	60	1.05	54
3	5	60	2.8	54

## SETTINGS

### Main Units

No setting is required since units are calibrated for

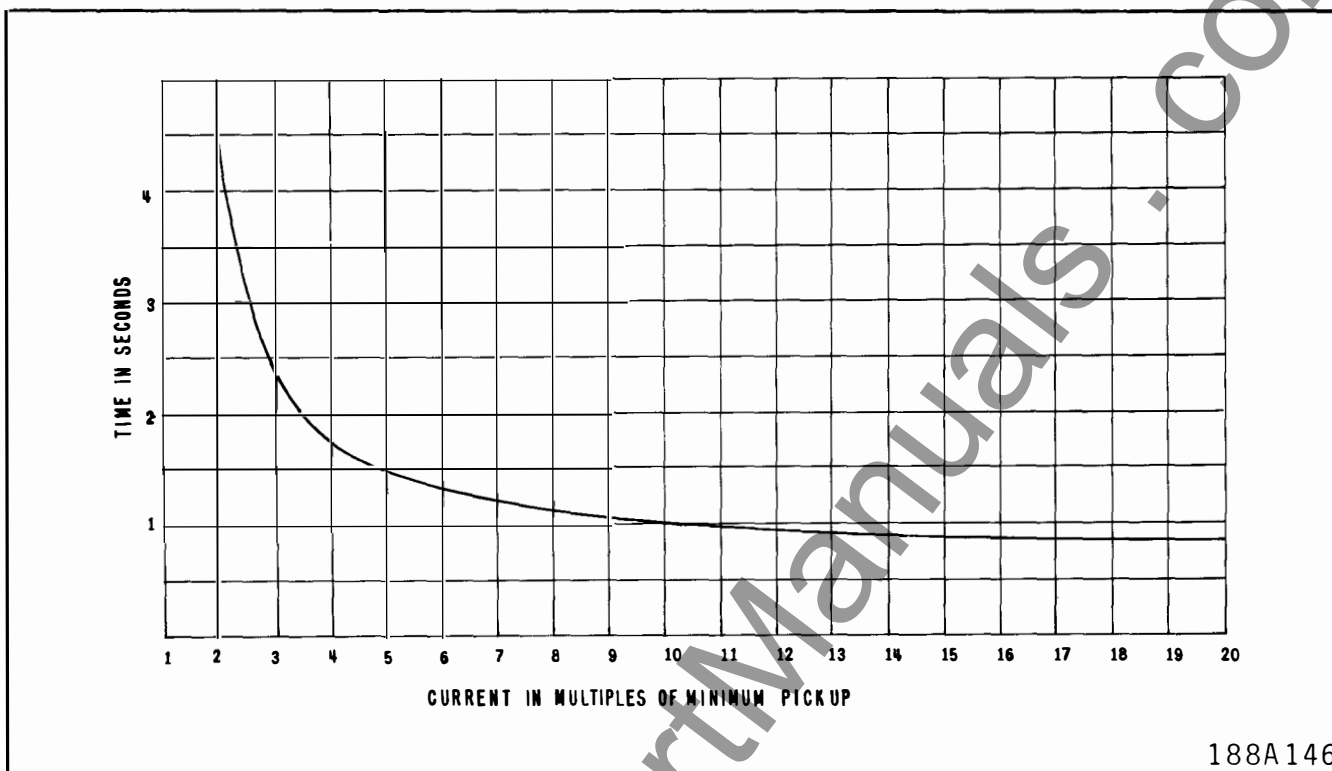


Fig. 5. Typical Time Curve of the Type CM Relay

one ampere sensitivity and are set to operate on an unbalance as shown in the operating curve of Fig. 4.

#### Indicating Contactor Switch (ICS)

No setting is required on the ICS unit except the selection of the 0.2 or 2.0 ampere tap setting. This selection is made by connecting the lead located in front of the tap block to the desired setting by means of the connecting screw.

#### A-C Indicating Contactor Switch (ACS)

No setting is required on the ACS unit with the core screw locked in its "all in" position, the unit should operate and drop its target at a value not greater than its rated operating current.

### INSTALLATION

The relays should be mounted on switchboard panels or their equivalent in a location free from dirt, moisture, excessive vibration and heat. Mount the relay vertically by means of the mounting stud for the type FT projection case or by means of the four mounting holes on the flange for the semi-flush type FT case. Either the stud or the mounting screws may be uti-

lized for grounding the relay. The electrical connections may be made directly to the terminals by means of screws for steel panel mounting or to the terminal stud furnished with the relay for thick panel mounting. The terminal stud may be easily removed or inserted by locking two nuts on the stud and then turning the proper nut with a wrench.

For detailed information on the FT case refer to I.L. 41-076.

### ADJUSTMENTS AND MAINTENANCE

The proper adjustments to insure correct operation of this relay have been made at the factory. Upon receipt of the relay no customer adjustments, other than those covered under "SETTINGS" should be required.

#### Acceptance Check

The following check is recommended to insure that the relay is in proper working order:

#### MAIN UNITS

For all electrical checks refer to test diagram Fig. 6. For tapped CM, put tap screw in one amp. setting.

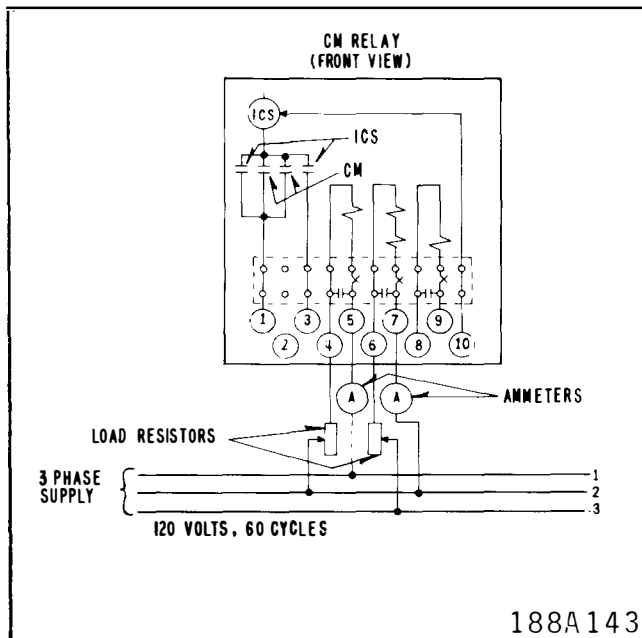


Fig. 6. Diagram of test connection for the non-tapped Type CM Relay in the FT31 Case. For tapped CM place tap screw in 1 amp. tap setting.

#### 1. Contacts

Stationary contacts assembly should be aligned with respective marks located on scale plate, prior to checking the relay.

#### 2. Minimum Trip Current

Note: The front electromagnet energized alone will produce a disc rotation to the left while a rear electromagnet energized alone will produce a disc rotation to the right.

Minimum trip can be checked by energizing either the front or rear electromagnets alone and noting that the moving contact makes with its respective stationary contact at one ampere.

#### 3. Balance Check

Apply one ampere through the front and rear electromagnets simultaneously. The moving contact should remain substantially midway between the stationary contacts. A similar check should be made utilizing six amperes.

#### 4. Time Curve

Contact travel is from balanced position to either the right or left stationary contacts.

Electromagnets are to be energized alone (zero restraint). Apply ten amperes and note that contacts make at one second  $\pm 10\%$ . Time curve characteristic per Fig. 5.

#### Indicating Contactor Switch (ICS)

Close the main relay contacts and pass sufficient d-c current through the trip circuit to close the contacts of the ICS. This value of current should be not greater than the particular ICS tap setting being used. The operation indicator target should drop freely.

The contact gap should be approximately .047" between the bridging moving contact and the stationary contacts. The bridging moving contact should touch the stationary contacts simultaneously.

#### A-C Indicating Contactor Switch (ACS)

Close the main relay contacts and pass sufficient a-c current through the trip circuit to close the contacts of the ACS. This value of current should be not greater than the particular ACS rated operating current being used. The operation indicator target should drop freely.

The contact gap should be approximately 3/32" between the bridging contact and the adjustable stationary contacts. The bridging moving should touch both stationary contacts simultaneously.

#### Routine Maintenance

All relays should be inspected periodically and the time of operation should be checked at least once every year or at such other time intervals as may be dictated by experience to be suitable to the particular application. Phantom loads should not be used in testing induction-type relays because of the resulting distorted current wave form which produces an error in timing.

All contacts should be periodically cleaned. A contact burnisher #182A836H01 is recommended for this purpose. The use of abrasive material for cleaning contacts is not recommended, because of the danger of embedding small particles in the face of the soft silver and thus impairing the contact.

### CALIBRATION

Use the following procedure for calibrating the relay if the relay has been taken apart for repairs or the adjustments disturbed. This procedure should not be used until it is apparent that the relay is not in proper working order. (See "Acceptance Check").



## TYPE CM RELAY

### Main Units

For all electrical checks refer to test diagram Fig. 6.  
For tapped CM, put tap screw in one amp. tap setting.

#### 1. Balance Setting

- a) Mechanical balance-adjust spiral spring until moving contact is located substantially in the center of the scale plate.

#### b) Electrical Balance —

1. Apply two amperes on front and rear electromagnets and adjust resistor at rear of specific unit being tested such that the moving contact is in balance, i.e., moving contact is aligned per part "a" above.
2. Apply twenty amperes on front and rear electromagnets for approximately two seconds and note that the moving contact does not deviate from the balanced condition more than approximately 1/4 inch.

- \* For CM relays with adjustable magnetic plugs, only the right hand plug may be adjusted. At the factory, the right hand plug is adjusted to help obtain a balanced condition of the contact at 20 amperes. The moving contact is again checked at 2 amperes. Little adjustment, if any, is expected to be necessary in the field.

#### 2. Minimum Trip Setting

The front electromagnet energized alone should produce a disc rotation to the left while the rear electromagnet energized alone should produce a disc rotation to the right.

- a) Apply one ampere to front electromagnet and adjust left stationary contact until it just makes with the moving contact. This setting should correspond with the marking on scale plate.
- b) Apply one ampere to rear electromagnet and adjust right stationary contact until it just makes with the moving contact. This setting should correspond with marking on scale plate.

#### 3. Operating Curve

Apply six amperes to front electromagnet and vary current flowing through rear electromagnet.

- a) The moving contact should make with the right stationary contact between 6.5 and 7.1 amperes.

- b) The moving contact should make with the left stationary contact between 5.5 and 5.0 amperes.

#### 4. Time Curve

Note: Contact travel is from balanced position to either the right or left stationary contacts.

- a) Apply 10 amperes to rear electromagnet (front electromagnet de-energized) and adjust permanent magnet for an operating time to right contact of  $1.0 \pm .05$  second.
- b) Apply 10 amperes to front electromagnet (rear electromagnet de-energized) and check to see that operating time to left contact is  $1.0 \pm .10$  seconds.

### Indicating Contactor Switch (ICS)

Close the main relay contacts and pass sufficient d-c current through the trip circuit to close the contacts of the ICS. This value of current should not be greater than the particular ICS tap setting being used. The operation indicator target should drop freely.

### A-C Indicating Contactor Switch (ACS)

Close the main relay contacts and pass sufficient a-c current through the trip circuit to close the contacts of the ACS. This value of current should not be greater than the particular ACS rated operating current being used. The operation indicator target should drop freely.

## RENEWAL PARTS

Repair work can be done most satisfactorily at the factory. However, interchangeable parts can be furnished to the customers who are equipped for doing repair work. When ordering parts, always give the complete nameplate data.




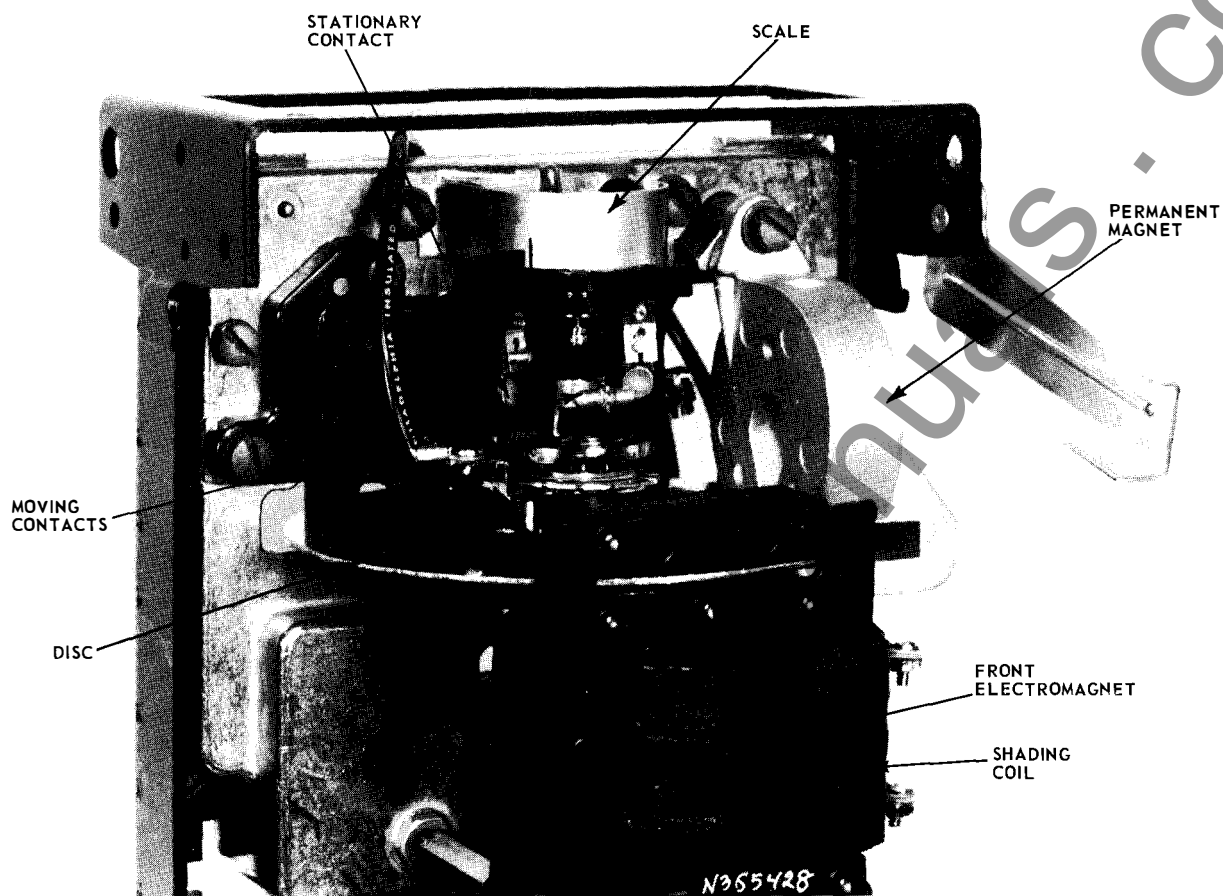


Fig. 8. Element Assembly Drawing for non-tapped CM Relay (Front View)

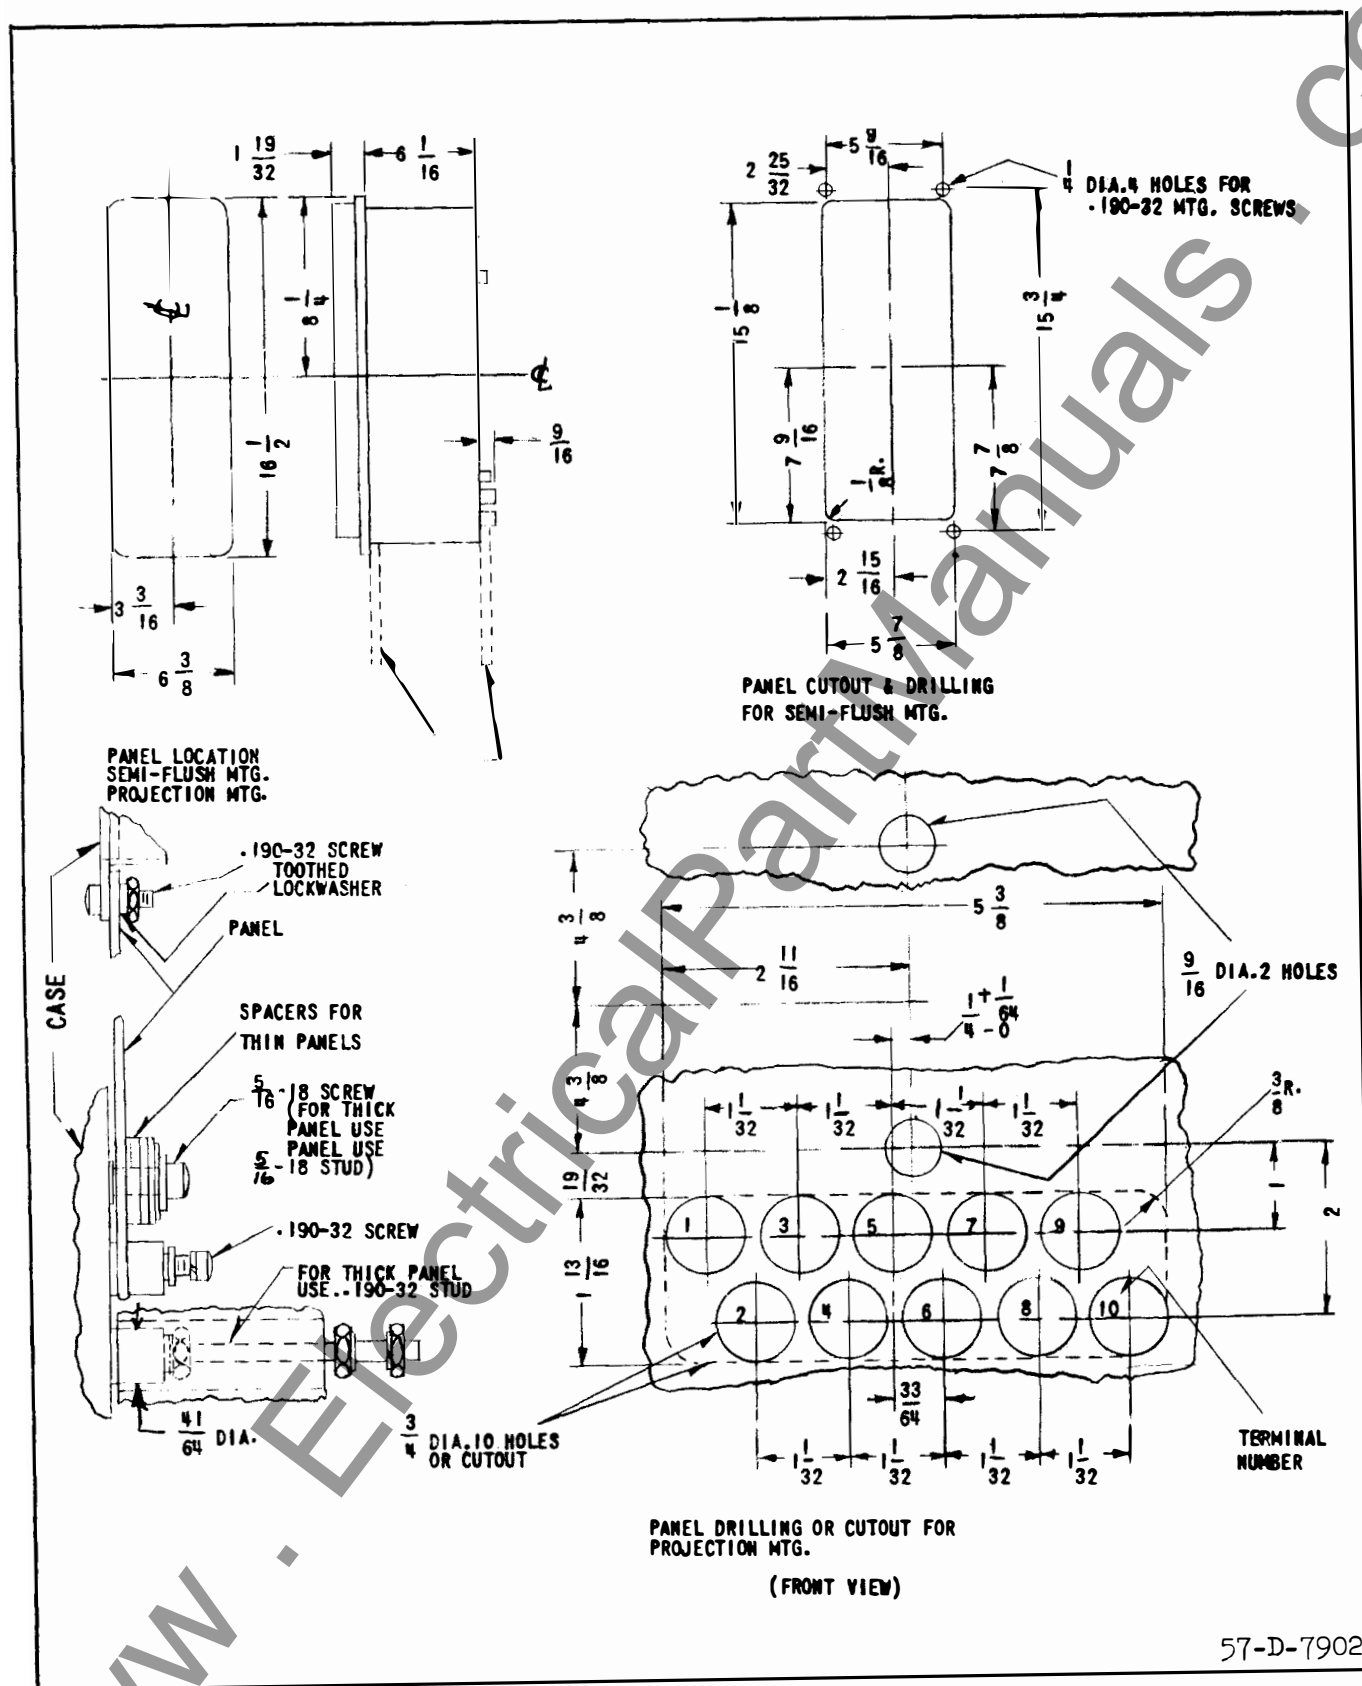

57-D-7902

Fig. 9. Outline and Drilling Plan for the Type CM Relay in the Type FT-31 Case

[www.ElectricalPartManuals.com](http://www.ElectricalPartManuals.com)



**WESTINGHOUSE ELECTRIC CORPORATION**  
**RELAY-INSTRUMENT DIVISION**

**NEWARK, N. J.**

Printed in U.S.A.